

**Atari Technical Bulletin**  
**Number: TT30-0003**  
**Date: March 24, 1992**  
**Page 1 of 2**

Product(s) Affected: TT030  
Model: All  
Type of ATB: As Needed  
ECO #: N/A

**Reason for ATB:**

To correct improper jumper setting causing coprocessor to run at 16MHz instead of 32MHz.

**Notes:**

Four FAB assemblies are affected by this ATB. They are marked as follows:

<b><u>FAB Number</u></b>	<b><u>REV</u></b>
C301763-001	D
C301763-001	B1
C302406-001	A

**Symptoms of Problem:**

Applications needing coprocessor support run slow.

**Solution:**

1. Remove the top cover. If the TOS ROMs are located on the left front side of the main PCB, remove the VME card guide.
2. Check jumper setting at W101.  
  
For FAB C301763-001 REV D and C302406-001 REV A see Figure 1 on page 2.  
  
For FAB C301763-001 REV B1 see Figure 2 on page 2.  
  
Be sure the jumper is parked across pins 1 and 2.
3. Re-assemble unit.

Atari Technical Bulletin  
Number: TT30-0003  
Date: March 24, 1992  
Page 2 of 2

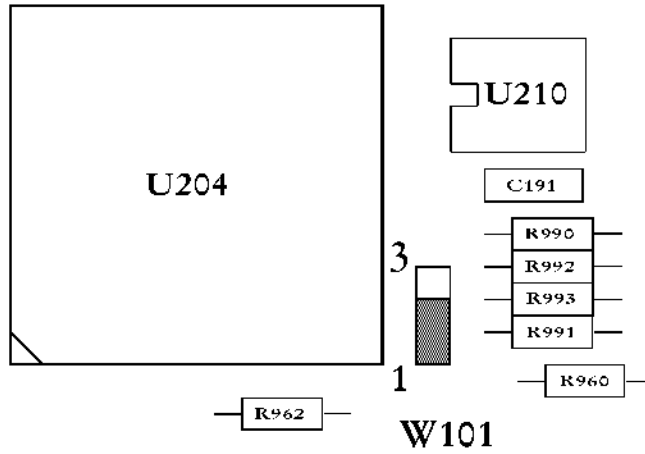


Figure 1

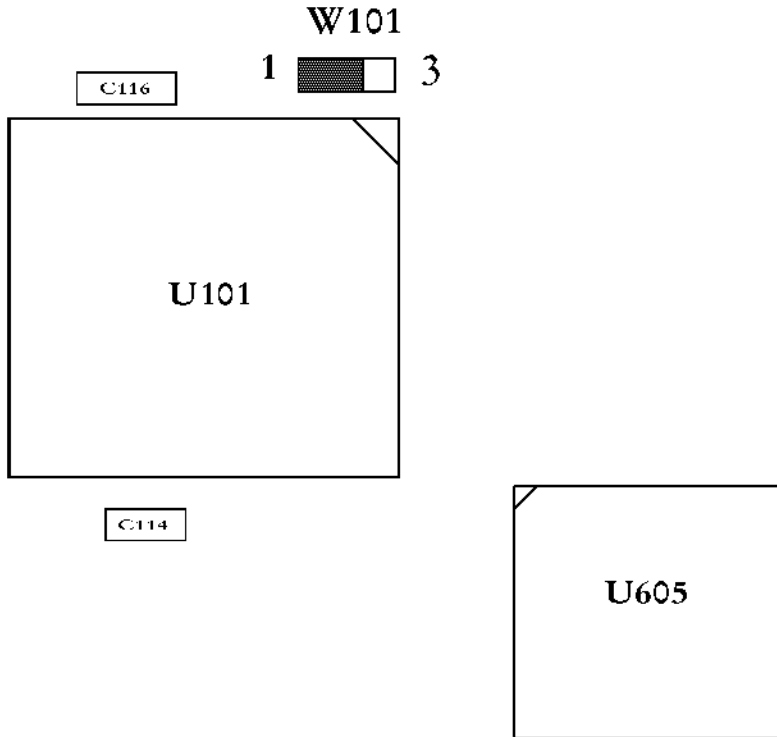


Figure 2